

Start Time: 8AM Finish: Noon

www.adairinspection.com

Property Faces: East
Outside Temp: 65°F - 82°F

Multilevel: TWO Weather: Clear Drought conditions Property ID: 2006-173

Realtor: NA Associate: NA

Payment: Check # 0001 Fee: \$600.00 Vacant

No attendees

1733 GOLIAD DR. GARLAND, TX 75042-4238

Office 972-487-5634

PROPERTY INSPECTION REPORT Confidential Report Prepared For: A Bank (Name of Client) Concerning: Classic Ln. Frisco, TX 75034 454

BARRY ADAIR #4563

(Name and License Number of Inspector)

(Date)

TEXAS REAL ESTATE COMMISSION STATEMENT:

(Address or Other Identification of Inspected Property)

The inspection of the property listed above must be performed in compliance with the rules of the Texas Real Estate Commission (TREC). The inspection is of conditions, which are present and visible at the time of the inspection and all of the equipment is operated in normal modes. The Inspector must indicate which items are in need of repair or are not functioning and will report on all applicable items required by TREC rules. This report is intended to provide you with information concerning the condition of the property at the time of inspection. Please read the report carefully. If any item is unclear, you should request the inspector to provide clarification. It is recommended that you obtain as much history as is available concerning this property. This historical information may include copies of any seller's disclosures previous inspections or engineering reports, reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. Property conditions change with time and use. Since this report is provided for the specific benefit of the client(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Additional information provided by the inspector:

THIS REPORT IS BASED UPON A VISUAL, NON-INVASIVE GENERAL INSPECTION OF THE ABOVE NAMED PROPERTY. THE ENTIRE REPORT AND THE INSPECTOR NAMED ARE INCAPABLE OF IDENTIFYING OR REVEALING ANY HIDDEN, CONCEALED, OR LATENT DEFECTS.

Thank you for choosing ADAIR INSPECTION (the Company). You (the Client(s) are my sole employer at this inspection. This report only reports on the items listed and only the present condition of those items. It reflects only if the items inspected are observed to be "operative" during the inspection or in need of immediate repair(s). Disclaimer of Warranties: ADAIR INSPECTION makes no, nor implies any guarantee or warranty to any of the items inspected or the following statements: 1) That all defects have been found or that (the Company) will pay for repair of disclosed, undisclosed, unobservable, disguised, or latent defects. 2)That any of the items inspected are designed or constructed in a good and or workmanlike manner. 3) That any of the inspected items will continue to perform in the future as they are at the time of inspection. 4)Life expectancy of any items inspected cannot be stated. In the event a dispute arises concerning the performance of this inspection. (the Client(s) agrees to notify (the Company) within five (5) days of (the Client(s) discovery of the basis for dispute so as to give (the Compan)y a reasonable oportunity to reinspect the property prior to the disputed condition being altered, modified, improved, or repaired. In the event a dispute cannot be resolved by (the Client(s) and (the Company), the parties agree to submit the dispute to Binding Arbitration through a mutually agreeable Inspector mediator or arbitrator paid for by (theClient(s). Actual damages are limited to the amount of the inspection fee. Exclusivity: (the Client(s) gives permission for ADAIR INSPECTION to discuss report findings with (theClient(s) agent, representative, or repair persons for the sake of clarification. All items noted in need of repairs shall have labor and materials estimates prior to closing. Investigating, sampling, and testing for any Environmental Issues is beyond the scope of this Inspection. Contact any of these Agencies for your specific needs and further information. www.cdc.gov Center for Disease Control 1-888-311-3435, www.epa.gov Environmental Protection Agency 1-800-887-6063, www.hud.gov Housing and Urban Development 214-767-8300, www.tdh.state.tx.us Texas Department of Health 1-888-963-7111. This Confidential Report is prepared exclusively for (the Client(s) named and is not intended for use by others. It is not transerable and copies or portions thereof are in no way an accurate representation of the performed inspection. Violators will be prosecuted. Buyer, by accepting this report, or relying upon it in any way, expressly agrees to all above Limitations and Disclaimers. Copy report and photos to my agent ☐ YES ☒ NO

Client(s) signature:	Fees are due at the time of the inspection
Report Promulgated by the Texas Real Estate Commission (TREC) P.O.	Box 12188 Austin, TX. 78711-2188. 1-800-250-8732 or 512-459-6544
www trec state ty us REL 7A-0	

ADAIR INSPECTION Confidential Report Identification: FNB

The entire document or any portion thereof is not intended for use by others. Violators will be prosecuted.

AFI=Appears to Function as Intended

NC=No Comments

I=Inspected NI=Not Inspected NP=Not Present R=Not Functioning or In Need of Repair
I NI NP R Inspection Item

Please Read the Entire Report

Additional pages may be attached to this report. This report may not be complete without the attachments. If an item is present in the property but is not inspected, the "NI" column will be checked and an explanation is necessary. The inspector may provide comments whether or not an item is deemed in need of repair. Repair Items may affect the health, safety, or welfare of the occupants, and systems integrity. Plumbing or Gas leaks, and all Electrical system deficiencies require immediate attention or discontinuance of use until all repairs are completed! Upon further investigation by professional contractors other components or items not listed may be determined to be in need of repair. Insurability of the structure and any of the components within is not determined by this inspection.

	professional contractors other components or items not listed may be determined to be in need of
repair. Insurabil I NI NP R	ity of the structure and any of the components within is not determined by this inspection. I. STRUCTURAL SYSTEMS
	A. Foundation Comment: If all crawl space areas are not inspected provide an explanation. An opinion on performance is mandatory. All foundation components cannot be totally observed due to floor coverings or sub terrain features. Foundations on clay soil require adequate and even moisture trees, shrubbery, and other foliage can cause transpiration damage. Depending on the design and method of original construction pier and beam foundations may require periodic leveling of the floor system. Slab Post Tension Cable Pier and Beam
	 P1- Front view of house The post tension slab on grade foundation appears to be supporting the walls and roof systems The foundation base has parge coat applied P6- Crack is present at garage floor no deflection or excessive expansion noted at this time, consult specialist for appropriate measures and monitor for further movement
	B. Grading and Drainage Comment: The general grade shall slope 6" in the first 10' away from all foundation types. Gutter systems require 5' extensions at downspouts. Pooling and erosion shall be avoided alongside any part of the foundation. Foundation area surface or sub surface drains are not inspected.
	 Required slope is present Gutters are installed with downspouts connected to sub terrain drains at numerous locations
	C. Roof Covering Comment: If the roof is inaccessible due to height, slope, or material type, report the method used to inspect. ☐ Composition ☐ Wood ☐ Tile ☐ Slate ☐ Other
	 Due to slope the roof was viewed from the eave edge by ladder and with binoculars from as many views as reasonable, the entire surface could not be inspected by these methods Laminate shingles appear to be applied correctly over builder felt Drip edge is present
	D. Roof Structure and Attic Comment: (If the attic is inaccessible, report the method used to inspect.)
	Type: Hip and Gable Reflects with 2v4 purlip braces

- 2x6 Rafters with 2x4 purlin braces
- 7/16" OSB decking
- 3/4 " TG OSB for service platform
- P20- Remove exposed nails at the foot traffic areas, known safety hazard
- P21- 12" Blown fiberglass Insulation at ceilings and 3 1/2 " fiberglass batt at walls
- The entire attic areas were not traversed due to insulation covering the joists and no visual pathway could be identified without disruption of the insulation

ADAIR INSPECTION Confidential Report Identification: FNB of or any portion thereof is not intended for use by others. Violators

<u>i ne entire</u>	ACCUMENT OF Any portion thereof is not intended for use by others. Violators will be prosecuted.
Linono	AFI=Appears to Function as Intended NC=No Comments cted NI=Not Inspected NP=Not Present R=Not Functioning or In Need of Repair
I=Inspe I NI NP R	cted NI=Not Inspected NP=Not Present R=Not Functioning or In Need of Repair Inspection Item
	E. Walls (Interior and Exterior) Comment: Sheetrock, Tile, Acme brick and cast stone Masonry,
	Wood product siding and trims
	Entry wall has an area that is unpainted
	P12- There is no lentil support for the cast stone work at the front window a crack is present
	and the surfaces are deflected uneven
	F. Ceilings and Floors Comment: Sheetrock ceilings, Tile, Wood, Carpet flooring
	1. John 193 and 1 19913 Comment. One carook comings, The, Wood, Carpet hooming
	P16- The tile is incomplete under the upstairs commode
	G. Doors (Interior and Exterior) Comment:
	D45. The control of t
	 P15- The veneer is damaged at the powder room closet door
\square	H. Windows Comment: Storm units, shutters, awnings, drapes, curtains, blinds, tint films, and
	associated hardware are not inspected. Only a random representative number of units are operated.
	There shall be at least one latch operable secondary means of egress unit in every room designated
	for the purpose of sleeping. Type: Metal Thermal glazing
	Tempered glass is present at the proper locations Master tub, front entry, baths, and widows within the swing paths of other deare.
	 within the swing paths of other doors P5- Advise installing tempered glass in all units under 18" off the floor at the dining, front
	bedroom, and Master bedroom
	Sociooni, and Master Sociooni
	I. Fireplace/Chimney Comment: Remote or auto control(s) are not inspected. Component
	malfunction can result in serious injury or death. http://www.csia.org/pressroom/press-inspection-
	levels-explained.htm
	Type: Metal with cement refractory panels at the fire box
	Energy source: Gas
	Advise conversion to gas logs system
	Secure the spark screens at both stationary sides
	The entire flue, crown cap and flue spark arrestor could not be visually inspected
	Label the fresh air supply lever
	Install a damper block
	Complete a Level II inspection before closing. See website link for further information
	Have the system inspected yearly before seasonal use
\square	J. Porches, Decks and Carports (Attached) Comment:
	or resolved, Beene and Carperte (ratability Comments
	Covered patio AFI
	K. Other Item Comment:
	Partial enclosure of the main back yard with a 6' white wood side by side picket fence
	installed on 2x3 rails and landscape timber posts
	Advise weather sealing all wood ASAP
	II. ELECTRICAL SYSTEMS Consult an Electrician for evaluation of the entire system and
	components when repairs are noted. Failure to repair all known hazards reported can result in fires,
	serious injury, or death. Safety Information: http://www.adairinspection.com/ElectricalSafety

ADAIR INSPECTION Confidential Report Identification: FNB

The entire document or any portion thereof is not intended for use by others. Violators will be prosecuted. AFI=Appears to Function as Intended NC=No Comments I=Inspected NI=Not Inspected NP=Not Present R=Not Functioning or In Need of Repair NΙ NP R Inspection Item **A.Service Entrance & Panels Comment: Underground SEC** 200 Amp Square D panel Panel Wire Type: Copper with Circuit Breakers and AFCI at all bedroom circuits Ground rod and clamped wire are present, are clamp connected bonded to the water supply system in the garage labeled blank cover plate B. Branch Circuits-Connected Devices and Fixtures Comment: (Report as in need of repair the lack of ground fault circuit interrupter protection where required.). Only a random representative number of outlets are tested. Devices controlled by remote, photocell switches, timers, landscape, or ground(s) lighting are not inspected. Antiquated wiring is a known hazard safety enhancement updating is advised. GFCI location document: http://www.ecmweb.com/mag/electric code basics 3/ P3- Install cover plate at the den receptacle P10- The AC disconnects do not have proper clearance from the equipment P19- Properly secure all excess wiring in the attic area, make certain NO wiring is in contact with metal strap material, known electrocution safety hazard All receptacles and switches that were viewed are side wired FYI: The GFCI protection for the Master bath, and shared bath downstairs is located at the powder room receptacle FYI: The exterior receptacles GFCI protection is located at the garage receptacle FYI: The hydro tub GFCI protection is located at the Master closet receptacle III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS (Note: Humidifier(s), dehumidifier(s), electric air filter(s), discharge pump(s), programmable thermostat(s), remote or auto control(s), and airflow balance is not inspected.) Luxury features, ancillary equipment, and thermostat(s) calibration are not inspected. Consult an HVAC technician when repairs are noted. A. Heating Equipment Comment: Only the emergency heat mode is tested on heat pumps when \square \square the outside temperature is above 60°. Heaters are tested when the outside temperature is above 80°. Complete seasonal equipment service is advised. Type: Zoned forced air Up and Down Energy Source: Gas

- Attic installed horizontal
- P22- Unit #2 Label
- P23- Unit #1 Label
- Neither unit operated due to the thermostats being locked at 68°F and the interior temp was at 78°F

ADAIR INSPECTION Confidential Report Identification: FNB

The entire document or any portion thereof is not intended for use by others. Violators will be prosecuted.

AFI=Appears to Function as Intended NC=No Comments

I=Inspected NI=Not Inspected NP=Not Present R=Not Functioning or In Need of Repair

		l=	Inspe	cted NI=Not Inspected NP=Not Present R=Not Functioning or In Need of Repair
I	NI	NP	R	Inspection Item
\boxtimes				B. Cooling Equipment Comments: The equipment is not operated when outside temperature is below 60 °F outside. (See Note above.) Complete seasonal equipment service is advised. Type and Energy Source: Zoned Electric Forced Air Downstairs Return Temp. 78 °F Supply Temp. 53-64 °F Upstairs Return Temp. 78 °F Supply Temp. 64-65 °F
				 Neither unit meet thermostatic differential when measured at the return and closest supply registers and systems balance is advised Both labels were either absent or covered at the evaporator coils therefore compatible
				 sizing could not be determined Numerous impact dents are present at the condensing units fins P7- Condensing Unit #1 label
				 P8- Condensing Unit #2 label P9 - Both units are rated 14 SEER per labels The magnetic filter door is broken at Evaporator coil #1, replace
				 Advise installation of pan float overflow switches at both units Insulate the entire exposed length of the condensate drain lines Condensates drain at bath lav tail pipes
X				A. Ducts and Vents Comment:
				 Metallic Louvered with Flex duct FYI: Filters size is 20"x25"x1"
				IV. PLUMBING SYSTEM Note: Insulate all exposed supply pipes in the attic, crawlspace, and outdoors and protect from freezing. All pipes, reservoirs, and all related equipment concealed in enclosures or under ground are not inspected for leaks, defects, or nonworking parts. Some of the components are unobservable therefore; the system is only inspected for the presence of fixtures and visual function. Sub terrain systems, sumps, chlorinators, chemical dispensers, water conditioners, ionization devices, and any other ancillary equipment are not inspected nor included as part of this report. Consult a Plumber when repairs are noted.
X				A. Water supply System and Fixtures Comment: (See Plumbing System Note) Type: Copper
				 The center trim cap is absent at the shared bath tub valve P2- Secure the pipes at the kitchen sink P13- Water pressure entering house is 80 lbs. P14- The laundry sink is yet installed and the valve knobs are absent P17- Adjust the float at the upstairs commode so waste overflow does not occur FYI: There are service stop valves for both hot and cold at all sink and lav fixtures, cold only at the commodes
X				B. Drains, Wastes, Vents Comment: (See Plumbing System Note) Type: PVC
				 P2- Escutcheon seal the pipes at the kitchen sink cabinet P11- Cleanout is blocked by brick and mortar

ADAIR INSPECTION Confidential Report Identification: FNB

The entire document or any portion thereof is not intended for use by others. Violators will be prosecuted.

AFI=Appears to Function as Intended NC=No Comments

	l=	Inspe	cted NI=	Not Inspected	NP=Not Present	R=Not Functioning or In Need of Repair
I NI	NP	R			Inspection Item	
			listed as r	ecognized hazard	ds by TREC rules.)	ort as in need of repair those conditions specifically of Units: 2 AO Smith Water Temp: 121°F
			•			itches at both drain pans
				therapy Equipmof the pump motor		re access panel, GFCI outlet, and ground wire
			V ADDII		cess panel present to	service the pump motor, install
			V. APPLI			
M L	JЦ		Dishwasl inspected		peration is inspected i	n Normal cycle only. Luxury features are not
			•	There is a cou	nter top air gap device	present
			•		ply to this unit was off	
			•	The soap disp	enser door is caked a	the latch an will not close
			•			oved at the disposal or the drain line is clogged I
				had to stop the	e cycle to avoid floodin	g
\square	П	П	B. Food	Waste Disposa	Comment:	
		_				
			•	AFI		
			•	InSinkErator		
	1 [П	C. Range	Hood Commen	<u> </u>	
	- —		•			
			•	AFI Whirlpool		
			•		into the microwave	
			•	Vented to the		
			•	4 speed fan wi	th automatic heat sen	sor
		\boxtimes				k, timer, auto cook, self-clean, rotisserie, probe not inspected for accuracy or operation.
			•	Whirlpool		
			•	·	gy Source: Gas 4 burn	er electronic ignition
			•			Electric with bake and broil elements at both units
			•			47°F Lower Set at 350°F= 327°F
			•			ight cooktop burner 9ppm during low setting
				· ·		el 4 (high speed) consult appliance tech for
				calibration, kno	own safety hazard pot	ential
			E. Microv	wave Cooking E	quipment Comment:	Units are not checked for radiation leakage.
		_		_		Ţ
			•	Whirlpool AFI		
			•	Turntable cont		
			•	Nightlight and		
			•	warmed water	during 1 minute test	

ADAIR INSPECTION Confidential Report Identification: FNB

The entire document or any portion thereof is not intended for use by others. Violators will be prosecuted.

AFI=Appears to Function as Intended NC=No Comments

		Ari=Appears to Function as intended in NC=No Confinents
	=Inspe	· · · · · · · · · · · · · · · · · · ·
I NI NF	R	Inspection Item
		F. Trash Compactor Comment:
		• NC
	JШ	G. Bathroom Exhaust Fans and/or Heaters Comment: Timer(s) are not inspected for accuracy or
		operation. Heat Source: HVAC Supply registers present
		Experient form are present at the hotter provider record formed in contract to the context of
		 Exhaust fans are present at the baths, powder room, and laundry vented to the exterior
	1 🗆	H. Whole House Vacuum System Comment:
	• Ш	NC
		I. Garage Door-Operators Comment: Inspected in manual and installed wall switch control
		operation only. Remote controls and auxiliary keypads are not inspected. Please read these articles
		and inspect doors monthly: http://www.dasma.com/safetygdmaint.asp
		http://www.dasma.com/PDF/Publications/TechDataSheets/CommercialResidential/TDS167.pdf
		Non-insulated metal door
		 Reversing Sensor and Motion Sensor AFI
		Hardware and rails appear secure
	Ш	J. Doorbells and Chimes Comment: Intercom, radio, and other luxury features are not inspected.
		- AEI
		• AFI
	1 [K. Dryer Vents Comment: Clear lint filter(s) of debris after each use; this will reduce a known fire
	. Ш	hazard, dry time, and energy costs.
		mazara, ary time, and energy ecoto.
		FYI: Updraft unit requires more frequent inspection and cleaning to avoid known
		hazards
		Vented to exterior
		L. Other Built in Appliances Comment:
		 FYI: The refrigerator opening is 37" wide and advise maximum 70" tall for proper coil
		ventilation, unit is not present
		VI ODTIONAL SYSTEMS

ADAIR INSPECTION Confidential Report Identification: FNB

The entire document or any portion thereof is not intended for use by others. Violators will be prosecuted.

AFI=Appears to Function as Intended NC=No Comments

		l=	Inspe	cted NI=Not Inspected NP=Not Present R=Not Functioning or In Need of Repair
I	NI	NP	R	Inspection Item
				 A. Lawn Sprinklers Comment: Operated in manual mode only. The timer, control box, rain sensor, or effectiveness and sizing of anti-siphon valves or backflow prevention are not inspected. Rainbird AFI 6 zones with approximately 50 heads Advise adjusting, relocating, or changing head types to avoid impact of walls, fence, window, and AC condensers
				B. Swimming pools/Spas and Equipment Comment: Water table is not determined. All ancillary equipment such as cleaning or testing supplies, computer controls, covers, chlorinators, chemical dispensers, water conditioners, or ionization devices are not inspected. Information: http://www.adairinspection.com/Pool-SpaSafety Gunite Fiberglass Vinyl Lined Freeze Guard DE Sand Cartridge Cleaner • NC
П	П	\boxtimes		C. Outbuildings Comment:
				• NC
		\boxtimes		D. Outdoor Cooking Equipment Comment: Energy Source: Gas Electric Manual
				• NC
				E. Gas Lines Comment: Gas leak detection is performed at the meter, service cutoff valve connections and appliance connections, only, with a TIF 8800 LEAK DETECTOR. Type: Black Iron
				 F. Water Wells Comment: Coliform analysis and other testing are necessary for safe water assurance. Consult the local Water Board for Coliform Analysis and Well Inspection Referrals. NC
		\boxtimes		G. Septic Systems Comment: Information: http://www.adairinspection.com/SepticInspection
				• NC
				H. Security Systems Comment: Surveillance and other luxury features are not inspected. Brink's Home Security inspects and provides a report or promo packet for homes with or without alarm systems present. Brink's will pay, to <i>ADAIR INSPECTION</i> , a portion of this inspection fee for providing this service. By signing this document, you agree to receive sales calls from Brink's.
				 See Brink's report for details The system is inactive at this time Windows are interior side mount sensored

Page 9 of 9

ADAIR INSPECTION Confidential Report Identification: FNB

The entire document or any portion thereof is not intended for use by others. Violators will be prosecuted.

AFI=Appears to Function as Intended NC=No Comments

I=Inspected NI=Not Inspected NP=Not Present R=Not Functioning or In Need of Repair

I NI NP R Inspection Item

I. Fire Protection Equipment Comment: The installation of smoke alarm(s) is required inside of all bedrooms and in any rooms designated for the purpose of sleeping and outside within the proximity of the doors to these rooms. These units shall be hard wired with a battery backup and all units shall sound when one unit is activated. Test all alarms and detectors monthly by both test button and smoke. The installation of Carbon Monoxide detector(s) is required in homes with gas-fired appliances at every floor elevation and for appropriate square footage coverage. The installation of Type ABC fire extinguisher(s) at the kitchen, laundry, mechanical equipment areas, and garage, if applicable, is also advised. Test all of these devices monthly. Install new batteries yearly. Initiate and practice plans of escape and protection for all occupants in case any emergencies arise. The lack of these detectors or equipment is a known safety hazard, remedy, repair, or install immediately. For further information consult your local Fire Department and equipment manufacture. http://www.nfpa.org/index.asp and http://www.carbonmonoxidekills.com

AFI

Special Comments and Miscellaneous Page:

- 1) I, as an inspector am a generalist and do not claim to be an expert in any one area or field. I was hired to provide a written opinion on the specific items and their function during the time of inspection only.
- 2) Have any noted repairs completed by licensed, insured, and bonded professional contractors. All repairs shall strictly adhere to Manufacture Specifications, Federal, State, Local codes, and the Authority having Jurisdiction.
- 3) Maintain mature plantings a minimum of 3' from the roof, walls, A/C equipment, and all overhead wiring.
- 4) Maintain all exterior finishes, caulking, and other sealants at any unlike material abutments and all penetrations to the walls and roof. This inexpensive task prevents moisture intrusion and saves costly repairs.
- 5) Product recalls and consumer product safety alerts are added almost daily. To best address your specific concerns visit. www.cpsc.gov or www.recalls.gov

Item(s), brand name(s), and model number(s) will be required for proper identification.

- 6) Due to the age of some properties. Items noted as in need of repair are possible retrofits or upgrades to operating systems or fixtures already in place. Occupant health, safety, and welfare are paramount!
- 7) Some items not noted on this report were delivered verbally onsite when the client is present.
- 8) The entire report is not, nor is the Inspector named Licensed to perform any Code Inspections pertaining to this specific property. All Code Enforcement questions must be directed to the Authority Having Jurisdiction. Contact the local Building Department for further details.

Safety-Security-Serenity

THANK YOU FOR CHOOSING ADAIR INSPECTION Signed: BARRY ADAIR Dated: 09-20-2006